



J. H. FLETCHER & CO. Box 2187 – Huntington, WV 25722-2187 – 304/525-7811 – FAX 304/525-4025

# IMPORTANT SAFETY NOTICE

## FIELD CHANGE NOTICE

INFORMATION BULLETIN NO. 120

**TO: OWNERS OF FLETCHER ROOF BOLTERS 2011123, 2011124, 2011125, 2011126, 2011127, 2011128, 2011135, 2011136, 2011137, 2011138**

**FROM: J.H. FLETCHER & CO.  
RISK MANAGEMENT DEPARTMENT**

**DATE: JANUARY 2013**

**SUBJECT: PERMISSIBILITY COMPLIANCE – UNDERSIZED CABLE**

Part No. 515219 electric motors from Baldor are 50hp, 440/550 volt re-connectable. They were supplied to us with a size 8 cable instead of a size 6 cable that is in the specification. This is the cable from the motor to the starter box. The starter box glands are the grommet style glands and the grommet for the size 6 cable is not permissible with the size 8 cable that was installed.

Fletcher is providing a kit, part no. 530845, to correct this problem.

Enclosed is a verification form to complete and return to Fletcher when the kit has been installed.

When the change out has been completed return the old parts to Fletcher, attention David Cooper, or to your local Fletcher service representative.

THIS DOCUMENT, WHOLE OR IN PART, MAY NOT BE REPRODUCED IN ANY FORM WITHOUT THE PERMISSION OF J.H. FLETCHER & CO.  
PUBLICATION OF LESS THAN THIS COMPLETE DOCUMENT COULD BE MISLEADING TO THE READER  
IF YOU HAVE ANY QUESTIONS, OR TO REQUEST PERMISSION TO REPRODUCE THIS DOCUMENT,  
CONTACT THE RISK MANAGEMENT DEPARTMENT

FLETCHER®

