


NOTICE: OUTDATED TEXT  
DO NOT RELY UPON THIS TEXT. THIS TEXT IS FOR  
INFORMATION PURPOSES ONLY. FOR CURRENT  
INFORMATION, CONTACT  
J.H. FLETCHER & CO.  
RISK MANAGEMENT DEPT.

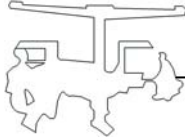

J. H. FLETCHER & CO. Box 2187 – Huntington, WV 25722-2187 – 304/525-7811 – FAX 304/525-4025

# IMPORTANT SAFETY NOTICE

## INFORMATION BULLETIN NO. 21

**TO: OWNERS AND OPERATORS OF FLETCHER MODEL DDO AND DDJ ROOF DRILLS**

**FROM: J.H. FLETCHER & CO.  
RISK MANAGEMENT DEPARTMENT**

**DATE: UNKNOWN**

**SUBJECT: FRONT END LIFT ARRANGEMENT ON MODELS DDO AND DDJ**

### Problem:


The allen head screws in the retaining cap for the bronze bushing begin to back out after continued use of the front end lift system.

### Solution:

To prevent this occurrence, tack weld the allen head screws along with welding the retaining cap to the pivot plate.

See the attached drawing.

Contact the Risk Management Department with any questions.

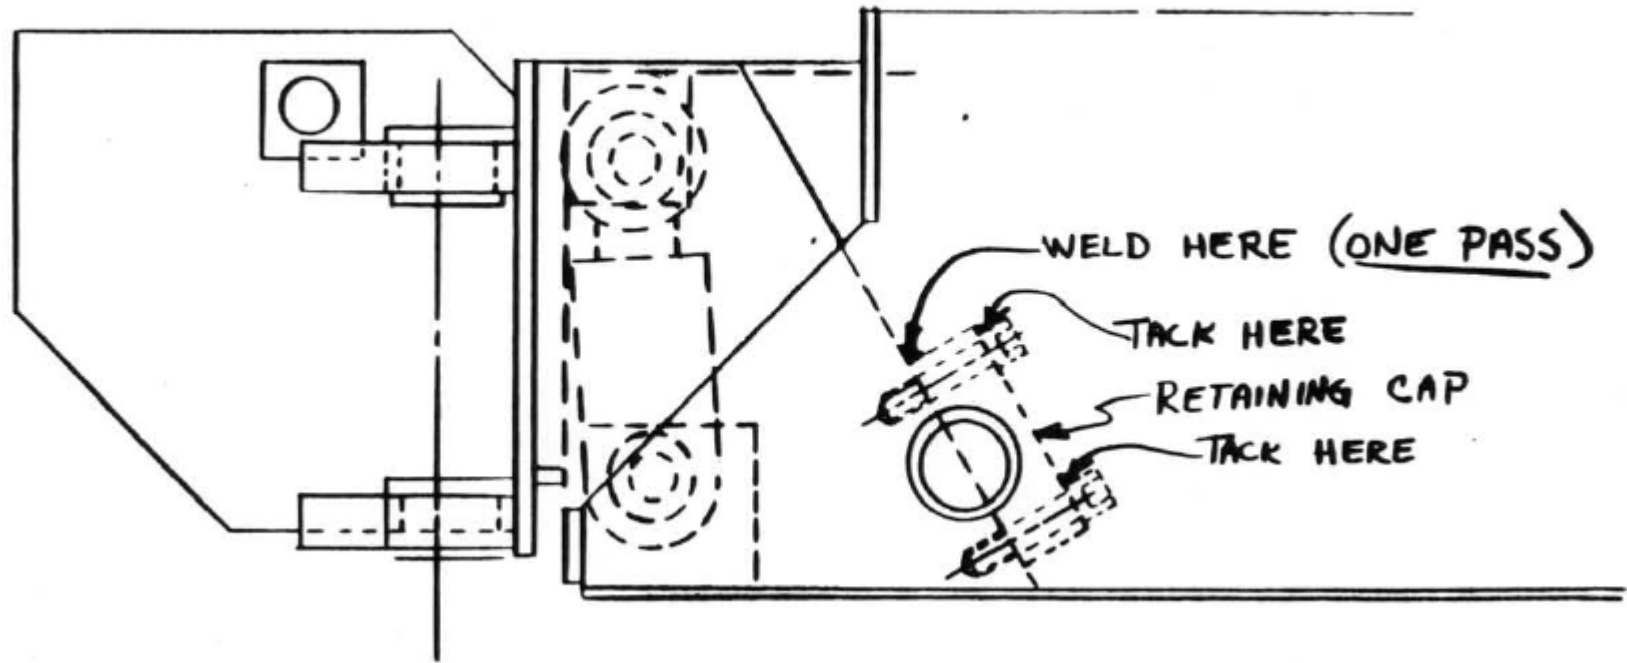

WELD AREAS FOR RETAINER